



# QuickStart Instructions

Turn on & **push Zero button if needed.** Maximum pressure is 60 psi. Readout is to .1 psi. Gauge shuts off automatically if not in use (pressure changes).


Press the **ON** button just hard enough to turn the unit on.  
Excessive pressure is not needed and can cause premature wear on the button.

Battery indicator is on the upper right side of the display. When needed replace with 2) quality "AAA" alkaline batteries. Door is on back of gauge. Pull rubber bumper back for access.  
**DO NOT DROP THE UNIT OR GET IT WET. DO NOT EXPOSE TO STRONG ELECTRIC OR MAGNETIC FIELDS.** (caster camber gauge magnets?)

**EXCESSIVE PRESSURE MAY DAMAGE THE GAUGE. See rating.**

**TO CONVERT TO METRIC** turn unit on, then push and hold ZERO until it flashes. Release ZERO, then push again to change. Units are displayed on the right side. Options are: psi, BAR, & kPa. When you get what you want the gauge reverts to normal function in 3 seconds and stays until you change it again.

Low Battery  
indicator

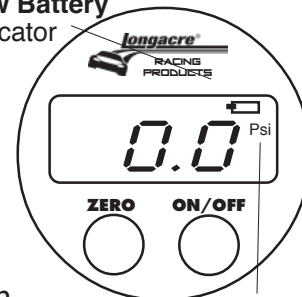

Units

**Longacre®**

## New Style Digital Gauge

You have received the latest gauge head. It has several improvements over previous models and because of this it operates slightly differently.

- REPLACEMENT BATTERIES ARE 2) AAA, ACCESSED FROM THE BACK.
- Gauge shuts off after 3 minutes of no use. However it will stay on as long as you are using it (pressures changing). Because of this the auto-off time is not adjustable.
- Accuracy has been improved from .5% to .3% and operating temperature range increased. This model should not need field recalibration.
- **Low Battery** indication is in the upper right corner of the display.